


Trapezowa nakrętka z gwintem jednokrotnym z kołnierzem, tolerancja H7

Materiał

Bronz Rg 7

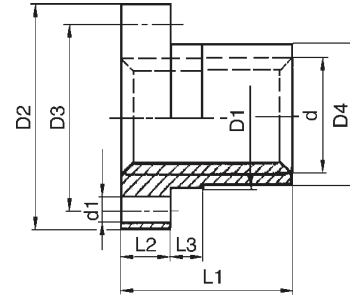

Prawy Kod	Lewy Kod	Wymiar d x P	D1 h9	D2	D3	D4 -0.2 / -0.3	Otwory kołnierza			L1	L2	L3
							d1	Gwint				
T 44327	T 44347	Tr. 10 x 2	25	42	34	25	5	M 4	25	10	8	
T 44328	T 44348	Tr. 10 x 3	25	42	34	25	5	M 4	25	10	6	
T 44329	T 44349	Tr. 12 x 3	28	48	38	28	6	M 5	35	12	8	
T 44330	T 44350	Tr. 14 x 4	28	48	38	28	6	M 5	35	12	8	
T 44331	T 44351	Tr. 16 x 4	28	48	38	28	6	M 5	35	12	8	
T 44332	T 44352	Tr. 18 x 4	28	48	38	28	6	M 5	35	12	8	
T 44333	T 44353	Tr. 20 x 4	32	55	45	32	7	M 6	44	12	8	
T 44334	T 44354	Tr. 22 x 5	32	55	45	32	7	M 6	44	12	8	
T 44335	T 44355	Tr. 24 x 5	32	55	45	32	7	M 6	44	12	8	
T 44336	T 44357	Tr. 26 x 5	38	62	50	38	7	M 6	46	14	8	
T 44337	T 44358	Tr. 28 x 5	38	62	50	38	7	M 6	46	14	8	
T 44338	T 44360	Tr. 30 x 6	38	62	50	38	7	M 6	46	14	8	
T 44339	T 44361	Tr. 32 x 6	45	70	58	45	7	M 6	54	16	10	
T 44340	T 44363	Tr. 36 x 6	45	70	58	45	7	M 6	54	16	10	
T 44341	T 44365	Tr. 40 x 7	63	95	78	63	9	M 8	66	16	12	
T 44342	T 44366	Tr. 44 x 7	63	95	78	63	9	M 8	66	16	12	
T 44343	T 44367	Tr. 48 x 8	72	110	90	72	11	M 10	75	18	14	
T 44344	T 44368	Tr. 50 x 8	72	110	90	72	11	M 10	75	18	14	
T 44345	T 44369	Tr. 60 x 9	88	130	110	88	13	M 12	90	20	16	

Rozmiary w mm.

UWAGA:

Otwory w kołnierzu (d1) 6 x 60°.